
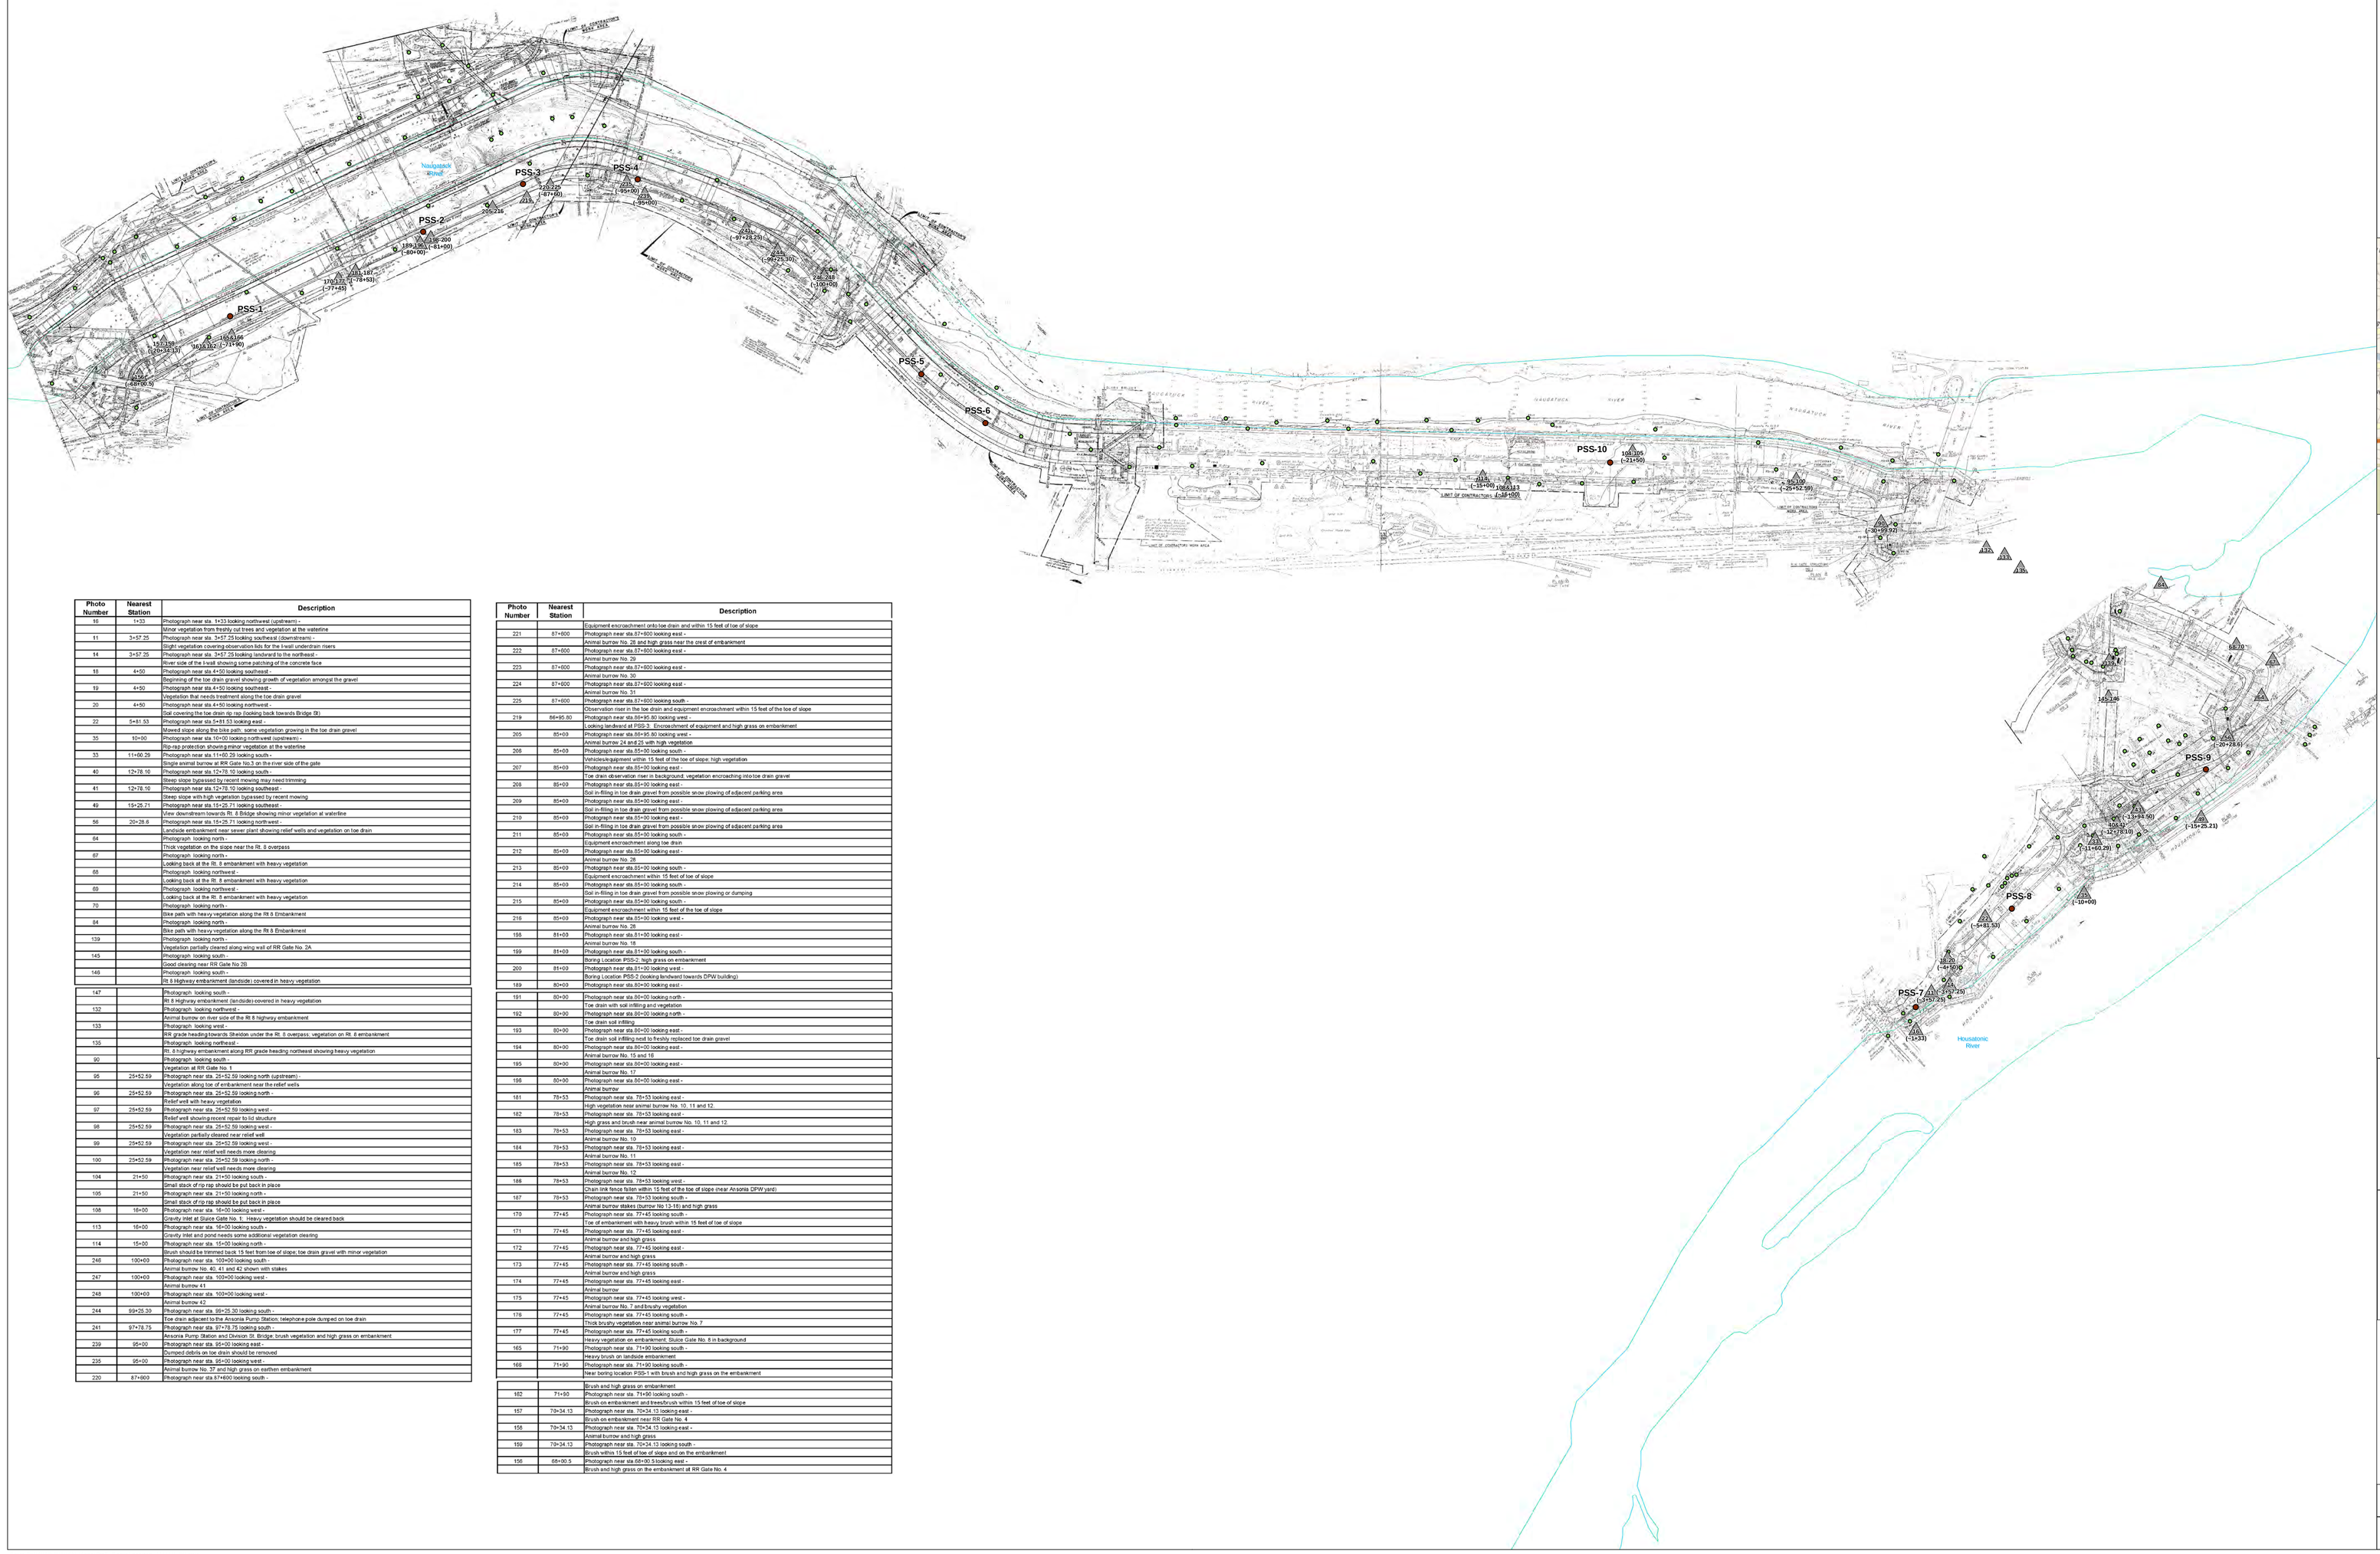


Photo Number	Nearest Station	Description
16	1+33	Photograph near sta. 1+33 looking northwest (upstream) -
		Minor vegetation from freshly cut trees and vegetation at the waterline
11	3+57.25	Photograph near sta. 3+57.25 looking southeast (downstream) -
		Slight vegetation covering storm drain lids for the 3 east underdrain risers
14	3+57.25	Photograph near sta. 3+57.25 looking landward to the northeast -
		River side of the 3 wall showing some patching of the concrete face
18	4+50	Photograph near sta.4+50 looking southeast -
		Beginning of the toe drain gravel showing growth of vegetation amongst the gravel
19	4+50	Photograph near sta.4+50 looking southeast -
		Vegetation that needs treatment along the toe drain gravel
20	4+50	Photograph near sta.4+50 looking northeast -
		Soil covering the toe drain rip rap (looking back towards Bridge 39)
22	5+51.53	Photograph near sta.5+51.53 looking east -
		Mowed slope along the bike path, some vegetation growing in the toe drain gravel
35	10+30	Photograph near sta.10+00 looking northwest (upstream) -
		Rip-rap protection showing minor vegetation at the waterline
53	11+00.29	Photograph near sta.11+00.29 looking south -
		Single animal burrow at RR Gate No.3 at the river side of the gate
40	12+78.10	Photograph near sta.12+78.10 looking south -
		Steep slope bypassed by recent mowing may need trimming
41	12+78.10	Photograph near sta.12+78.10 looking southeast -
		Steep slope with high vegetation bypassed by recent mowing
49	15+25.71	Photograph near sta.15+25.71 looking southeast -
		View downstream towards Rt. 8 Bridge showing minor vegetation at waterline
56	20+28.6	Photograph near sta.15+75.71 looking northwest -
		Landside embankment near sewer plant showing relief wells and vegetation on toe drain
64		Photograph looking north -
		Thick vegetation on the slope near the Rt. 8 overpass
67		Photograph looking north -
		Looking back at the Rt. 8 embankment with heavy vegetation
68		Photograph looking northwest -
		Looking back at the Rt. 8 embankment with heavy vegetation
69		Photograph looking northwest -
		Looking back at the Rt. 8 embankment with heavy vegetation
70		Photograph looking north -
		Bike path with heavy vegetation along the Rt 8 Embankment
84		Photograph looking north -
		Bike path with heavy vegetation along the Rt 8 Embankment
139		Photograph looking north -
		Vegetation partially cleared along wing wall of RR Gate No. 2A
145		Photograph looking south -
		Good clearing near RR Gate No 2B
146		Photograph looking south -
		Rt. 8 Highway embankment (landside) covered in heavy vegetation
147		Photograph looking south -
		Rt 8 Highway embankment (landside) covered in heavy vegetation
132		Photograph looking northwest -
		Animal burrow on river side of the Rt 8 highway embankment
133		Photograph looking west -
		RR grade heading towards Sheldon under the Rt. 8 overpass; vegetation on Rt. 8 embankment
135		Photograph looking northeast -
		Rt. 8 highway embankment along RR grade heading northeast showing heavy vegetation
90		Photograph looking south -
		Vegetation at RR Gate No. 3
95	25+52.59	Photograph near sta. 25+52.59 looking north (upstream) -
		Vegetation along toe of embankment near the relief wells
96	25+52.59	Photograph near sta.25+52.59 looking north -
		Relief well with heavy vegetation
97	25+52.59	Photograph near sta. 25+52.59 looking west -
		Relief well showing recent repair to lid structure
98	25+52.59	Photograph near sta. 25+52.59 looking west -
		Vegetation partially cleared near relief well
99	25+52.59	Photograph near sta. 25+52.59 looking west -
		Vegetation near relief well needs more clearing
100	25+52.59	Photograph near sta. 25+52.59 looking north -
		Vegetation near relief well needs more clearing
104	21+50	Photograph near sta. 21+50 looking south -
		Small stack of rip rap should be put back in place
105	21+50	Photograph near sta. 21+50 looking north -
		Small stack of rip rap should be put back in place
108	16+00	Photograph near sta. 16+00 looking west -
		Gravity Inlet at Sluice Gate No. 1. Heavy vegetation should be cleared back
113	16+00	Photograph near sta. 16+00 looking south -
		Gravity Inlet and pond needs some additional vegetation clearing
114	15+00	Photograph near sta. 15+00 looking north -
		Brush should be trimmed back 15 feet from toe of slope; toe drain gravel with minor vegetation
246	100+00	Photograph near sta. 100+00 looking south -
		Animal burrow No. 40, 41 and 42 shown with stakes
247	100+00	Photograph near sta. 100+00 looking west -
		Animal burrow 43
248	100+00	Photograph near sta. 100+00 looking west -
		Animal burrow 43
244	99+25.20	Photograph near sta. 99+25.20 looking south -
		Toe drain adjacent to the Ansonia Pump Station; telephone pole dumped on toe drain
241	97+78.75	Photograph near sta. 97+78.75 looking south -
		Ansonia Pump Station and Division St. Bridge; brush vegetation and high grass on embankment
239	95+00	Photograph near sta. 95+00 looking east -
		Dumped debris on toe drain should be removed
235	95+00	Photograph near sta. 95+00 looking west -
		Animal burrow No. 37 and high grass on earthen embankment
230	87+600	Photograph near sta.87+600 looking south -

Photo Number	Nearest Station	Description
221	87+600	Equipment encroachment onto toe drain and within 15 feet of toe of slope
		Photograph near sta.87+600 looking east -
222	87+600	Animal burrow No. 28 and high grass near the crest of embankment
		Photograph near sta.87+600 looking east -
223	87+600	Animal burrow No. 29
		Photograph near sta.87+600 looking east -
224	87+600	Animal burrow No. 30
		Photograph near sta.87+600 looking east -
225	87+600	Animal burrow No. 31
		Photograph near sta.87+600 looking south -
219	86+95.80	Observation riser in the toe drain and equipment encroachment within 15 feet of the toe of slope
		Photograph near sta.86+95.80 looking west -
205	85+00	Looking landward at PSS-3. Encroachment of equipment and high grass on embankment
		Photograph near sta.85+95.80 looking west -
206	85+00	Animal burrow 24 and 25 with high vegetation
		Photograph near sta.85+00 looking south -
207	85+00	Vehicles/equipment within 15 feet of the toe of slope; high vegetation
		Photograph near sta.85+00 looking east -
208	85+00	Toe drain observation riser in background. vegetation encroaching into toe drain gravel
		Photograph near sta.85+00 looking east -
209	85+00	Soil in-filling in toe drain gravel from possible snow plowing of adjacent parking area
		Photograph near sta.85+00 looking east -
210	85+00	Soil in-filling in toe drain gravel from possible snow plowing of adjacent parking area
		Photograph near sta.85+00 looking east -
211	85+00	Soil in-filling in toe drain gravel from possible snow plowing of adjacent parking area
		Photograph near sta.85+00 looking south -
212	85+00	Equipment encroachment along toe drain
		Photograph near sta.85+00 looking east -
213	85+00	Animal burrow No. 26
		Photograph near sta.85+00 looking south -
214	85+00	Equipment encroachment within 15 feet of toe of slope
		Photograph near sta.85+00 looking south -
215	85+00	Soil in-filling in toe drain gravel from possible snow plowing or dumping
		Photograph near sta.85+00 looking south -
216	85+00	Equipment encroachment within 15 feet of the toe of slope
		Photograph near sta.85+00 looking west -
166	81+00	Animal burrow No. 18
		Photograph near sta.81+00 looking east -
169	81+00	Animal burrow No. 19
		Photograph near sta.81+00 looking south -
200	81+00	Boring Location PSS-2. high grass on embankment
		Photograph near sta.81+00 looking west -
189	80+00	Boring Location PSS-2 (looking landward towards DPW building)
		Photograph near sta.80+00 looking east -
191	80+00	Photograph near sta.80+00 looking north -
		Toe drain with soil infilling and vegetation
192	80+00	Photograph near sta.80+00 looking north -
		Toe drain soil infilling
193	80+00	Photograph near sta.80+00 looking east -
		Toe drain soil infilling next to freshly replaced toe drain gravel
194	80+00	Photograph near sta.80+00 looking east -
		Animal burrow No. 15 and 16
195	80+00	Photograph near sta.80+00 looking east -
		Animal burrow No. 17
196	80+00	Photograph near sta.80+00 looking east -
		Animal burrow
181	78+53	Photograph near sta. 78+53 looking east -
		high vegetation near animal burrow Nos. 10, 11 and 12.
182	78+53	Photograph near sta. 78+53 looking east -
		High grass and brush near animal burrow No. 10, 11 and 12
183	78+53	Photograph near sta. 78+53 looking east -
		Animal burrow No. 10
184	78+53	Photograph near sta. 78+53 looking east -
		Animal burrow No. 11
185	78+53	Photograph near sta. 78+53 looking east -
		Animal burrow No. 12
188	78+53	Photograph near sta. 78+53 looking west -
		Chain link fence fallen within 15 feet of the toe of slope (near Ansonia DPW yard)
167	78+53	Photograph near sta. 78+53 looking south -
		Animal burrow stakes (burrow No 12-18) and high grass
170	77+45	Photograph near sta. 77+45 looking south -
		Toe of embankment with heavy brush within 15 feet of toe of slope
171	77+45	Photograph near sta. 77+45 looking east -
		Animal burrow and high grass
172	77+45	Photograph near sta. 77+45 looking east -
		Animal burrow and high grass
173	77+45	Photograph near sta. 77+45 looking south -
		Animal burrow and high grass
174	77+45	Photograph near sta. 77+45 looking east -
		Animal burrow
175	77+45	Photograph near sta. 77+45 looking west -
		Animal burrow No. 7 and Brushy vegetation
176	77+45	Photograph near sta. 77+45 looking north -
		Thick brushy vegetation near animal burrow No. 7
177	77+45	Photograph near sta. 77+45 looking south -
		Heavy vegetation on embankment. Sluice Gate No. 6 in background
165	71+90	Photograph near sta. 71+90 looking south -
		Heavy brush on landside embankment
168	71+90	Photograph near sta. 71+90 looking south -
		Near boring location PSS-1 with brush and high grass on the embankment
		Brush and high grass on embankment
162	71+50	Photograph near sta. 71+50 looking south -
		Brush on embankment and trees/brush within 15 feet of toe of slope
157	70+34.13	Photograph near sta. 70+34.13 looking east -
		Brush on embankment near RR Gate No. 4
158	70+34.13	Photograph near sta. 70+34.13 looking east -
		Animal burrow and high grass
159	70+34.13	Photograph near sta. 70+34.13 looking south -
		Brush within 15 feet of toe of slope and on the embankment
156	68+90.5	Photograph near sta 68+90.5 looking east -
		Brush and high grass on the embankment at RR Gate No. 4

Legend

- Photo Location
  Photo Location ID
  (Approximate Station)
- PSS-1 Test Boring Location and Number
- Historic Boring

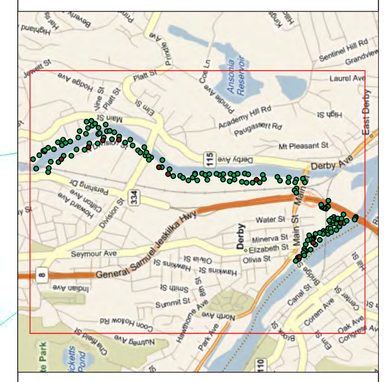

Source:
US Army Corps of Engineers, New England Division. 1967-1971.
ESRI StreetMap USA, 2007.

0 130 260 520
Feet

PS&S
integrating design & engineering
PAULUS, SOKOLOWSKI and SARTOR, LLC.
67A MOUNTAIN BOULEVARD EXTENSION
P.O. BOX 4039
WARREN, NEW JERSEY 07059
PHONE: (732) 560-9700

ANSONIA & DERBY LEVEE
SECTION 1
ANSONIA & DERBY, CT

PHOTOGRAPHIC LOCATION PLAN

Drn By: ML	Scale: 1" = 260'	Project: 04019.001
Ch'kd By: VL	Date: 11/11/2010	Plate No. : 5

Path: P:\04019\001\YW\Maps\Fig5_PhotoLocation_111110_00.mxd